

Lab Name: **Approved Testing Lab, Inc.**

Type of Report: **Nuclear Density Special Report**

<p>Client: <u>General Contractors Inc.</u></p> <p>Project Name: <u>Route 66</u></p> <p>Project Location: <u>Phoenix</u></p> <p>Material Type: _____</p> <p>Material Source: <u>Asphalt R Us</u></p>	<p>ATLI Job No.: <u>2547JTT306</u></p> <p>ADOT Tracs No.: <u>H447301C</u></p> <p>Report Date: <u>August 10, 2008</u></p>
--	---


ID	Date	Location	Lift	Target Density	Wet Density	% Comp	Lower Bound	Upper Bound	Test Result
1	8/4/08	Lot 11 southbound travel lane Sta 84+76 4" left of centerline	1	161	148.2	92%	91%	96%	Pass
2	8/4/08	Lot 11 southbound travel lane Sta 76+90 11" left of centerline	1	161	147.9	92%	91%	96%	Pass
3	8/4/08	Lot 11 southbound travel lane Sta 85+056 4" left of centerline	2	161	147.2	91%	91%	96%	Pass
4	8/4/08	Lot 11 southbound travel lane Sta 80+10 10" left of centerline	2	161	147.8	92%	91%	96%	Pass
5	8/4/08	Lot 11 southbound travel lane Sta 74+00 7" left of centerline	1	161	147.4	92%	91%	96%	Pass
6	8/4/08	Lot 11 southbound travel lane Sta 69+00 4" left of centerline	1	161	148.2	92%	91%	96%	Pass
7	8/4/08	Lot 11 southbound travel lane Sta 62+05 11" left of centerline	1	161	147.9	92%	91%	96%	Pass
8	8/4/08	Lot 11 southbound travel lane Sta 54+00 3" left of centerline	1	161	149.4	93%	91%	96%	Pass
9	8/4/08	Lot 11 southbound travel lane Sta 49+90 8" left of centerline	1	161	148.8	92%	91%	96%	Pass
10	8/6/08	Lot 11-A southbound travel lane Sta 73+25 10" left of centerline	2	161	149.3	93%	91%	96%	Pass
11	8/6/08	Lot 11-A southbound travel lane Sta 65+60 3" left of centerline	2	161	149.9	93%	91%	96%	Pass
12	8/6/08	Lot 11-A southbound travel lane Sta 55+00 19" left of centerline	2	161	147.4	92%	91%	96%	Pass
13	8/6/08	Lot 11-A southbound travel lane Sta 50+00 60" left of centerline	2	161	149.2	93%	91%	96%	Pass
14	8/6/08	Lot 12 southbound travel lane Sta 40+05 6" left of centerline	1	161	148.2	92%	91%	96%	Pass
15	8/6/08	Lot 12 southbound travel lane Sta 33+50 3" left of centerline	1	161	147.9	92%	91%	96%	Pass
16	8/6/08	Lot 12 southbound travel lane Sta 43+50 11" left of centerline	2	161	147.2	91%	91%	96%	Pass
17	8/6/08	Lot 12 southbound travel lane Sta 34+80 6" left of centerline	2	161	149.2	93%	91%	96%	Pass
18	8/6/08	Lot 12 southbound travel lane Sta 23+450 10" left of centerline	1	161	150	93%	91%	96%	Pass

Lab Name: **Approved Testing Lab, Inc.**

Type of Report: **Nuclear Density Special Report**

<p>Client: <u>General Contractors Inc.</u></p> <p>Project Name: <u>Route 66</u></p> <p>Project Location: <u>Phoenix</u></p> <p>Material Type: _____</p> <p>Material Source: <u>Asphalt R Us</u></p>	<p>ATLI Job No.: <u>2547JTT306</u></p> <p>ADOT Tracs No.: <u>H447301C</u></p> <p>Report Date: <u>August 10, 2008</u></p>
--	---

ID	Date	Location	Lift	Target Density	Wet Density	% Comp	Lower Bound	Upper Bound	Test Result
19	8/6/08	Lot 12 southbound travel lane Sta 15+10 4" left of centerline	1	161	161.4	100%	91%	96%	Pass
20	8/6/08	Lot 12 southbound travel lane Sta 00+05 10" left of centerline	1	161	148.3	92%	91%	96%	Pass
21	8/6/08	Lot 12 southbound travel lane Sta 02+00 6" left of centerline	1	161	148.25	92%	91%	96%	Pass
22	8/6/08	Lot 12 southbound travel lane Sta 24+98 19" left of centerline	2	161	148.1	92%	91%	96%	Pass
23	8/6/08	Lot 12 southbound travel lane Sta 19+08 3" left of centerline	2	161	147.8	92%	91%	96%	Pass
24	8/6/08	Lot 12 southbound travel lane Sta 13+50 13" left of centerline	2	161	148.7	92%	91%	96%	Pass
25	8/7/08	Lot 12+A southbound travel lane Sta 06+80 4" left of centerline	2	161	149.2	93%	91%	96%	Pass
26	8/7/08	Lot 12+A southbound travel lane Sta 03+25 10" left of centerline	2	161	149.4	93%	91%	96%	Pass

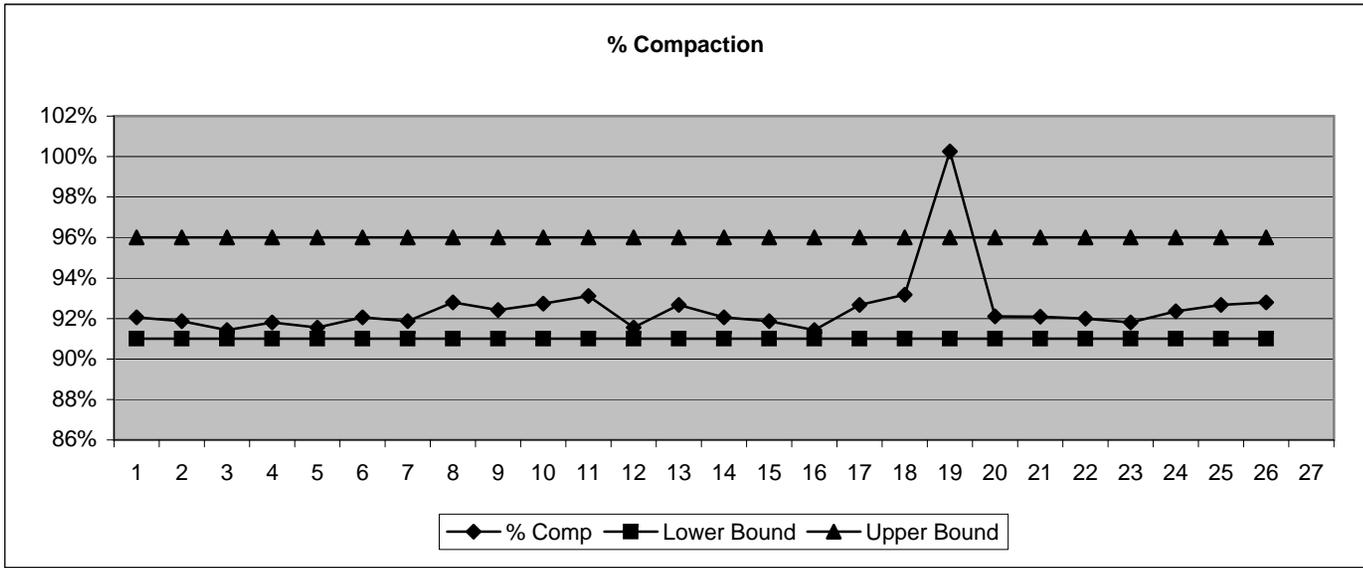

Lab Name: **Approved Testing Lab, Inc.**

Type of Report: **Nuclear Density Special Report**

Client: <u>General Contractors Inc.</u>	ATLI Job No.: <u>2547JTT306</u>
Project Name: <u>Route 66</u>	ADOT Tracs No.: <u>H447301C</u>
Project Location: <u>Phoenix</u>	Report Date: <u>August 10, 2008</u>
Material Type: _____	
Material Source: <u>Asphalt R Us</u>	

ID	Date	Location	Lift	Target Density	Wet Density	% Comp	Lower Bound	Upper Bound	Test Result
----	------	----------	------	----------------	-------------	--------	-------------	-------------	-------------

